


Gedrehte Crimpkontakte / Turned crimp contacts


Einzelkontakt <i>Single contact</i>	0,14 - 0,37 mm ²	26 - 22	100	VN01 016 0024 (1)C	VN02 016 0024 (1)C
	0,5 mm ²	20	100	VN01 016 0025 (1)C	VN02 016 0025 (1)C
	0,75 - 1,0 mm ²	20 - 16	100	VN01 016 0026 (1)C	VN02 016 0026 (1)C
	1,5 mm ²	16 - 15	100	VN01 016 0027 (1)C	VN02 016 0027 (1)C
	2,5 mm ²	14	100	VN01 016 0028 (1)C	VN02 016 0028 (1)C

Derating Kurven / Derating curves

Gestanzte Kontakte *Stamped contacts*

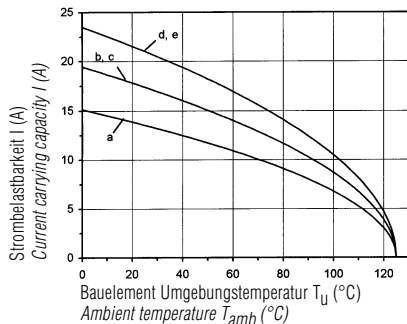

Gedrehte Kontakte *Turned contacts*

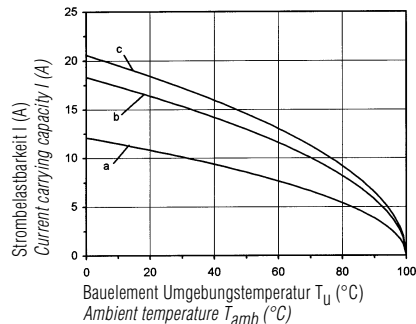

Kurve / Curve	Kontakt / Contact	Querschnitt / Wire gauge	Kurve / Curve	Kontakt / Contact	Querschnitt / Wire gauge
a	Standard gestanz	0,5 mm ²	a	Standard gedreht	0,5 mm ²
b	<i>Standard stamped</i>	1,5 mm ²	b	<i>Standard turned</i>	1,5 mm ²
c		2,5 mm ²	c		2,5 mm ²
d	Hochstrom gestanz	1,5 mm ²			
e	<i>High current, stamped</i>	2,5 mm ²			